


How to reset and recalibrate the touch screen overlay

Factory reset:

Steps:

- 1, Please uninstall our Touch Overlay driver if you have ever installed it. The OS will automatically use the built-in driver.
- 2, Connect the touch screen overlay to the computer
- 3, Download the calibration application from the following link
<http://www.cynnn.com/?p=868>
- 4, Unzip the file "CY-TouchSettingsV7.0_Win.zip" and run the app "CY-TouchSettingsV7.0_Win.exe"
- 5, Click and select the Language
- 6, Confirm that the application has found the touch screen overlay
(Product serial number will be displayed on the application)
- 7, Click "About" page, and click "factory reset"

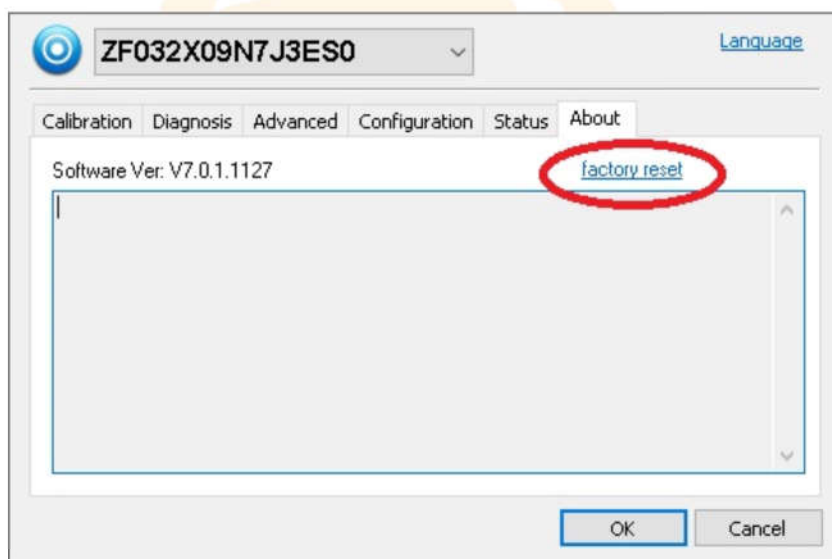

- 8, Click "yes" to confirm the factory reset.
- 9, Done.

Calibration:

Steps:

- 1, Run the app "CY-TouchSettingsV7.0_Win.exe"
- 2, Click and select the Language
- 3, Confirm that the application has found the touch screen overlay
(Product serial number will be displayed on the application)
- 4, Click "Calibration" to calibrate the touch screen overlay.

